


# AUSTRALIAN/NEW ZEALAND STANDARD FOR WINDSCREEN REPAIRS

## Critical Vision Area

Line up with centre of head rest

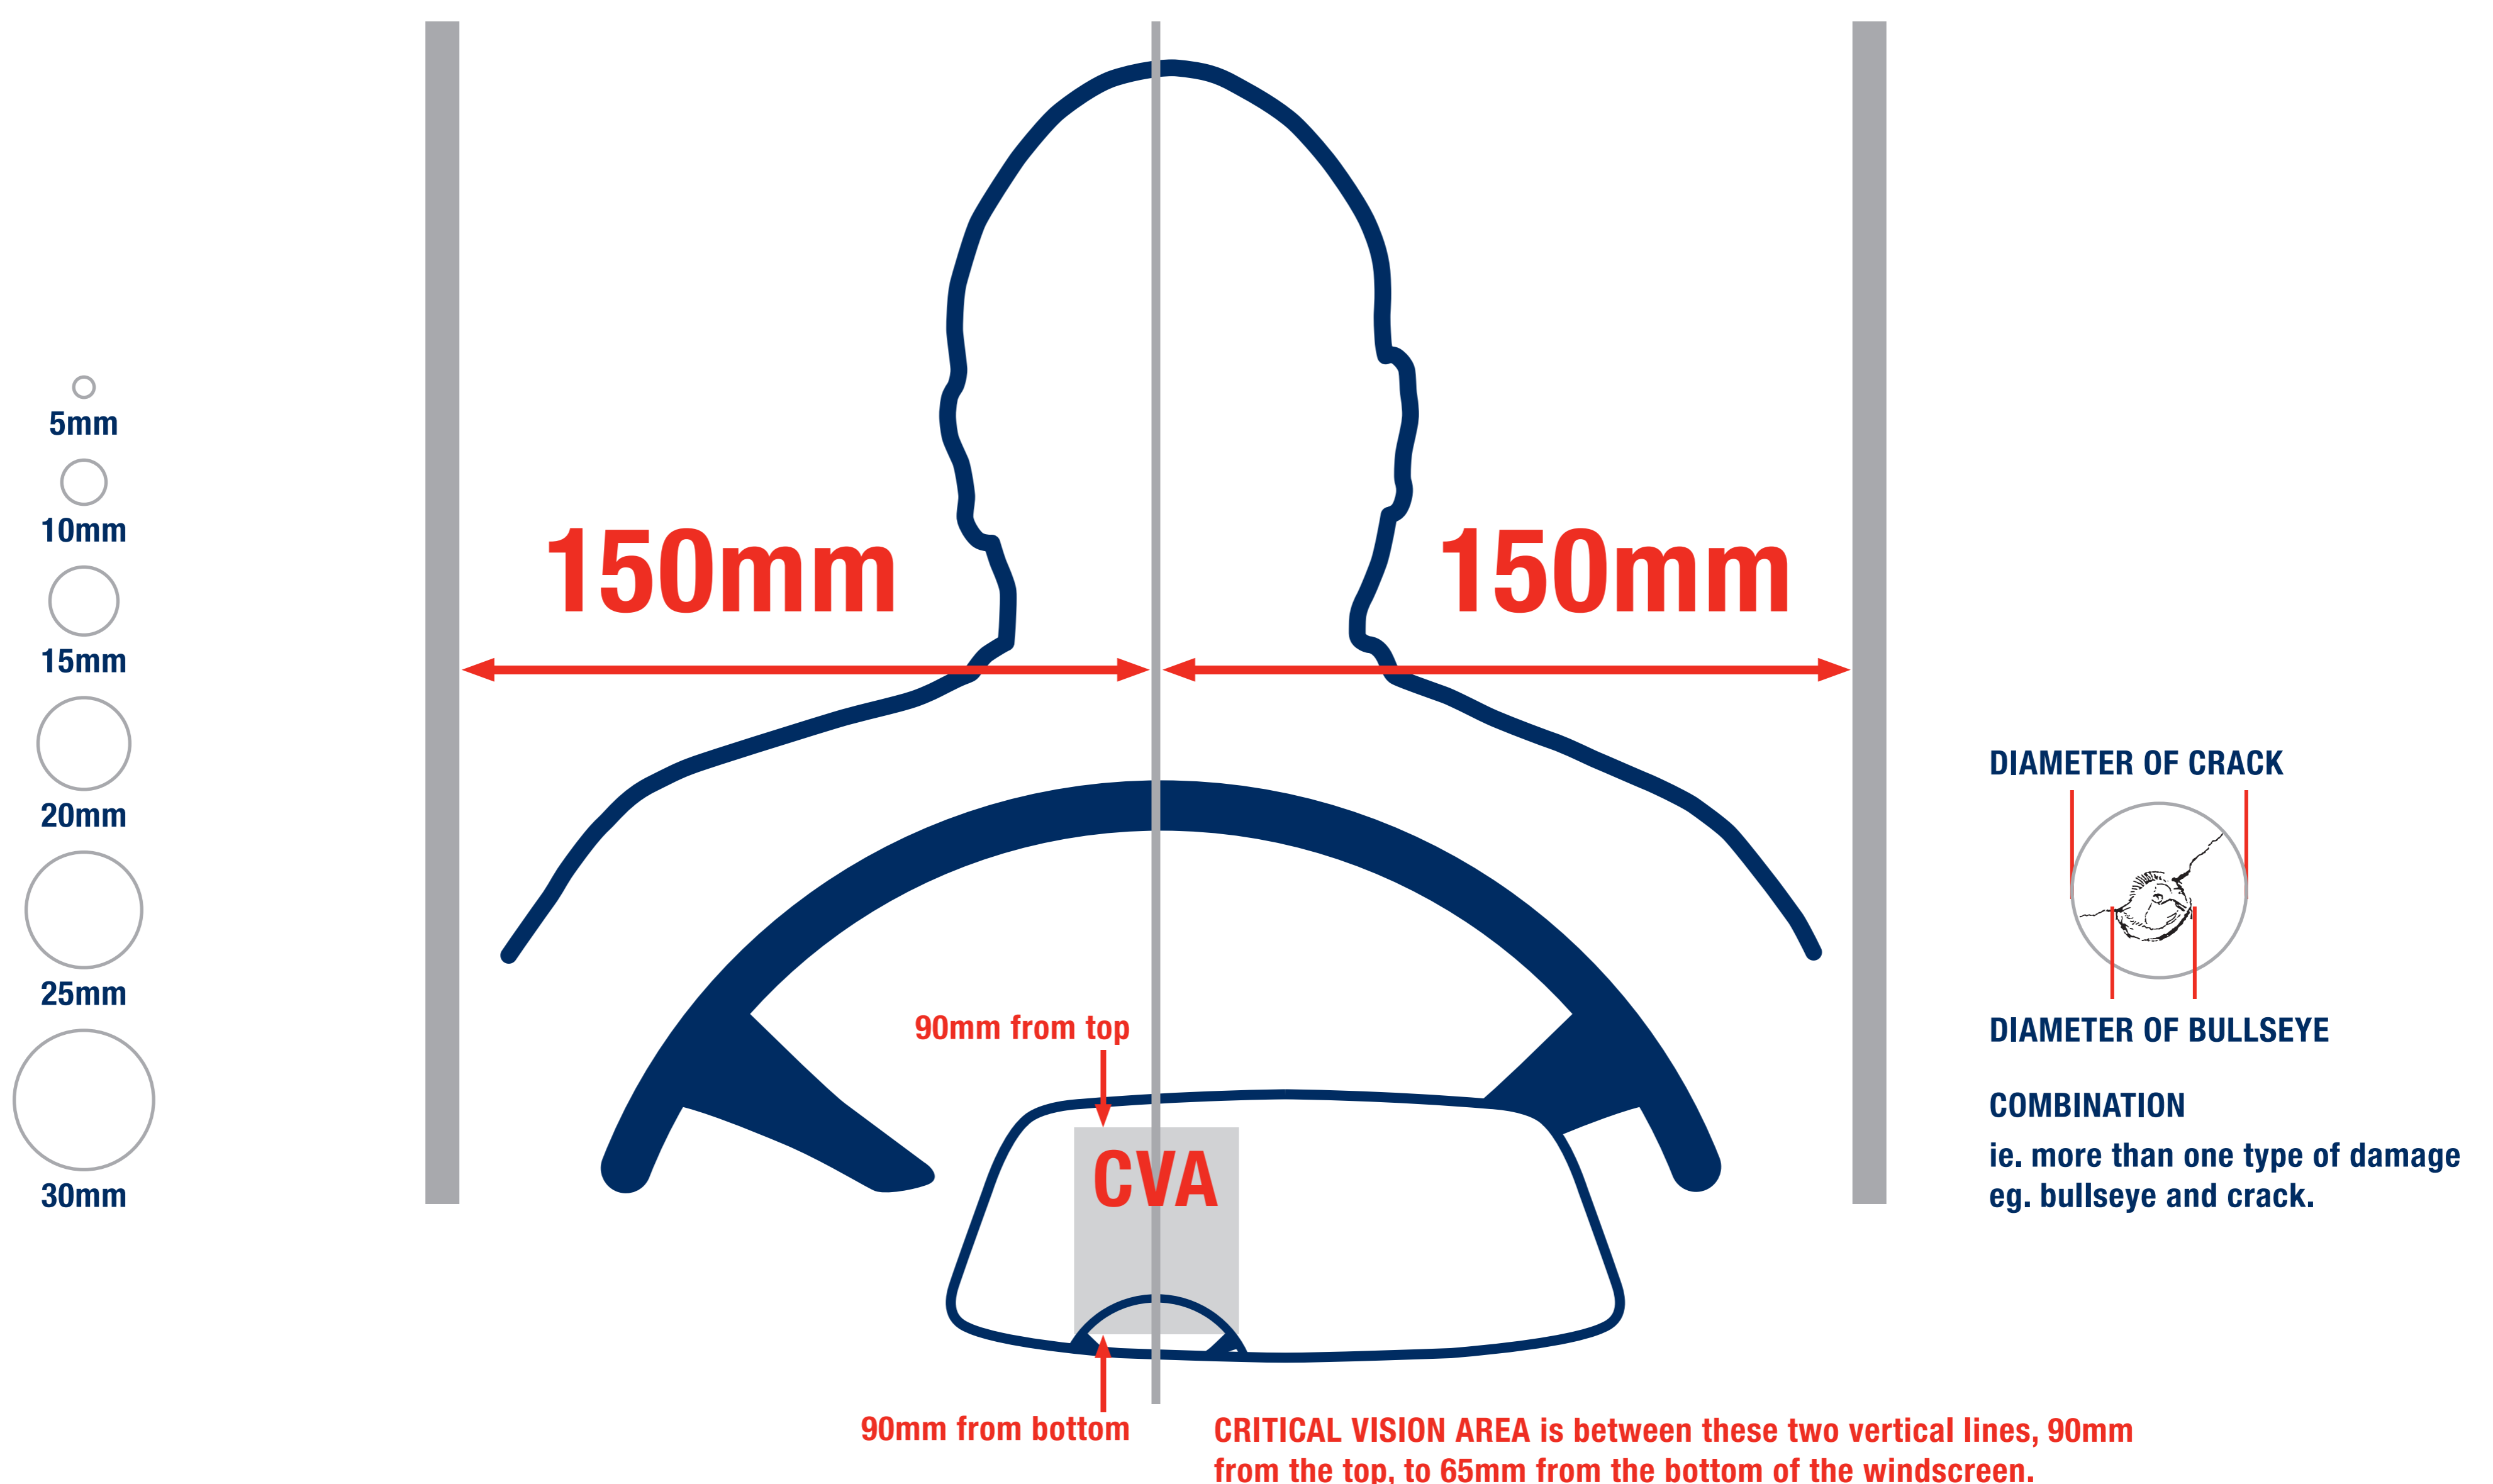

**CALL 0800 10 35 35 FOR MORE INFORMATION**

WINDSCREENS CAN BE REPAIRED IF THE DAMAGE IS NO LARGER THAN

TYPE OF DAMAGE	INSIDE CRITICAL VISION AREA	OUTSIDE CRITICAL VISION AREA
CRACK	25mm	350mm
STAR	15mm	30mm
HORSESHOE	10mm	25mm
BULLSEYE	10mm	20mm
CRATER	2mm	5mm
COMBINATION	As for each type of damage in the Combination	

THE STANDARD DOES NOT ALLOW REPAIRS IF

- A crack starts and finishes at the edge of the windscreen
- The damage affects more than the outer layer of glass
- The windscreen bonding layer has deteriorated
- There are eight or more repairs on the windscreen
- There is a previous repaired crack over 100mm
- Two or more previous repairs are in the Critical Vision Area (CVA) and the new damage is in the CVA
- An adjacent previous repair is in the overlay area and the new damage or previous repair is in the CVA